

Serviceordre – Materiell

Materiellsjef F/NLF kommuniserer pålegg omkring forhold som ansees som vesentlige for å oppnå de målsettinger som er satt for materiellarbeidet via denne Service ordre. Målgruppen for Serviceordre er Materiellkontrollører, Hovedinstruktører og andre nøkkelpersoner i miljøet.

SERVICEORDRE – 2013-2

HENVISNING:	Airtech GmbH Cypres 2 SB 31. Januar 2013
FORMÅL:	Kontrollere funksjonaliteten til Cypres 2 før hvert hopp.
STATUS:	Obligatorisk før <u>hvert</u> enkelt hopp.
IDENTIFIKASJON:	Alle Cypres 2 produsert fra februar 2009 til og med desember 2012. (også elev og tandem enheter)
BAKGRUNN:	Det er kommet inn rapporter til Airtech GmbH om at et lite antall Cypres 2 som er produsert mellom februar 2009 og desember 2012, ikke responderer etter at de er slått på. Det er påvist ulike årsaker til dette, se vedlagte SB fra produsent.
SERVICE:	Alle Cypres 2 som er produsert i det angjeldende tidsrommet vil bli oppdatert ved første fireårs kontroll.
UTFØRELSE:	<p>Alle som hopper Cypres 2 produsert i denne perioden skal etter at den er påslått, trykke på oppstart knappen en gang og sjekke at den røde ledlampen blinker. Dersom den gjør det fungerer Cypresen som forutsatt. Dette skal gjøres før hvert hopp.</p> <p>Hvis lampen ikke blinker, gjennomføres prosedyren en gang til, for å se om den blinker da. Hvis den fortsatt ikke gjør det, er ikke Cypresen trygg å hoppe med. I såfall kontakt Airtec GmbH for nærmere instruksjoner for å få Cypresen oppdatert eller erstattet. MR/MK eller forhandlere er behjelpelig med dette.</p> <p>Hovedinstruktører i klubbene skal påse at dette er kjent blant alle hoppere på feltet og at dette følges.</p>
DISTRIBUSJON:	Klubber Hovedinstruktører Materiellkontrollører SU Sky Design F/NLFs Internet sider Hærens Jegerkommando Luftfartstilsynet

Oslo, 05. februar 2013

Rolf I Sotberg
materiellsjef F/NLF

CYPRES 2 – Service Bulletin - 31 January 2013

Issue date: 31 January 2013

Bulletin number: C2 0113

Identification: CYPRES 2 units manufactured February 2009 through December 2012 (02/2009 - 12/2012).

Compliance: **MANDATORY before each jump**

Background:

Airtec GmbH & Co. KG has become aware of a small number of CYPRES 2 units becoming "non-responsive." Although the subject units indicated a "0" (or the selected DZ setting) on the display, they were no longer operating. Extensive research indicates that this situation is extremely rare and tends to occur during packing, especially on non-static-proof surfaces such as plastic, nylon or carpeted areas. Low humidity, build-up of static electricity and changing environmental conditions are all contributing factors. In addition, a recent activation, after the rig had been placed on the packing mat, has been linked to this phenomenon.

Action to be taken:

Prior to each jump, during your pre-boarding equipment check (**after** the CYPRES has been switched on), perform the following system test:

Click the control unit push button one time, and watch for the red LED light to flash. A flash indicates that the unit is working properly. If the red LED does not flash, repeat this procedure to confirm. **IF THE UNIT IS NOT RESPONDING, IT IS NOT IN A SAFE WORKING CONDITION, AND THE UNIT WILL NOT FUNCTION AS INTENDED ON A JUMP.** If this is the case, contact Airtec GmbH & Co. KG or SSK Industries, Inc. for further instructions either to arrange for repair, or for a loaner or replacement CYPRES 2.

If the unit is not in working condition, failure to perform this procedure prior to each jump will result in an increased risk to the user.

Resolution:

CYPRES 2 units manufactured after 1 January 2013 (01/01/2013) contain an update to prevent this situation from occurring.

All existing CYPRES 2 units in the field manufactured during the affected date range (identified above) will receive the update as they cycle through their periodic maintenance requirement, or during other repairs. After a CYPRES 2 unit receives the update, the procedure described above (clicking the control unit push button during each pre-boarding equipment check) is no longer required.

Additional Technical Details:

The reason that only units manufactured during the above date range are affected is because the manufacturer of a component made a change on an internal ASIC microcircuit (which is something like a processor) to a higher level of integration. Prior to accepting the revised component, Airtec went through a 13-month evaluation period. This included laboratory testing as well as field-testing of 151 CYPRES units with no events or anomalies experienced. The revised component entered CYPRES production in February 2009.

Authority:

Helmut Cloth
Airtec GmbH & Co. KG Safety Systems
Mittelstrasse 69
33181 Bad Wünnenberg, Germany
Tel: +49 2953-9899-0
Fax: +49 2953-1293
info@cypres.cc

Distribution:

North America Market & Dealers
North America Parachuting Publications
Parachute Industry Association