

Serviceordre – Materiell

Materiellsjef F/NLF kommuniserer pålegg omkring forhold som ansees som vesentlige for å oppnå de målsettinger som er satt for materiellarbeidet via denne Servicebulletin. Målgruppen for Service bulletinen er Materiellkontrollører, Hovedinstruktører og andre nøkkelpersoner i miljøet.

SERVICEORDRE – 2018-03

HENVISNING:	AAD Product Service Bulletin (PSB- 02-2018)
FORMÅL:	Inspeksjon av serienummer og sjekk om enheten er berørt av PSB 02-2018.
STATUS:	Obligatorisk ved neste hovedkontroll, men ikke senere enn 31 desember 2019.
IDENTIFIKASJON:	VIGIL II enheter med serienummer fra 16000 til 21999. Berørte serienummer finnes på https://www.vigil.aero/psb-check/ .
BAKGRUNN:	<p>Under inspeksjon av en Vigil som hadde en uventet aktivering ble en fleksibel elektrisk kobling funnet med knekk/bøy inne i enheten. Denne bøyde koblingen førte til en ustabil enhet som igjen førte til feilfunksjon og aktivering av nødåpner.</p> <p>Pr dags dato har over 200 enheter med samme kobling blitt inspisert hos AAD uten at man har funnet lignende problemer.</p>
SERVICE:	<p>Enheter som er berørt skal sendes direkte til produsent eller via forhandler (Spot On) som videresender til produsent.</p> <p>Innsendingen påvirker ikke periodisk kontroll (5 år ± 6 mnd)</p>
UTFØRELSE:	<p>Enhetens serienummer sjekkes mot https://www.vigil.aero/psb-check/.</p> <p>Loggkortet påføres «SO 2018-03 OK» av den MK eller MR som kontrollerer enheten</p>

DISTRIBUSJON:

Klubber
Hovedinstruktører
Materiellkontrollører
SU
Sky Design Verksted
Spot On
Skyvoss
F/NLFs internett sider
Forsvaret
Luftfartstilsynet

Trondheim, 24. oktober 2018

**Anders Opsal Mæland
materiellsjef F/NLF**

Issue Date : 23 October 2018

Bulletin Number : PSB-02-2018

Subject : Mandatory inspection.

Compliance : **MANDATORY: AT THE NEXT RESERVE REPACK, BUT NO LATER THAN 31 DECEMBER 2019.**

Identification : VIGIL II units SN from 16000 to 21999. Applicable serial numbers can be found at <https://www.vigil.aero/psb-check/>

***** This bulletin does not have any military Vigil SN's *****

Background:

After inspecting a Vigil that had an unexpected activation, a flexible electrical connection inside the Vigil unit was found in a folded state. This caused an unreliable connection that resulted in a unit malfunctioning. To date, over 200 Vigil II units with the same type of flexible connection have been inspected during maintenance, and no other unit has been found with this problem.

In the interest of user safety, AAD wants to inspect all Vigil II units that use the same specific type of flexible connection. This inspection must be made before 31 December 2019.

Compliance: VIGIL II.

To check if your Vigil is concerned, go to: <https://www.vigil.aero/psb-check/> where you can verify whether this service bulletin is applicable to your Serial Number. The range of possible serial numbers involved is from 16.000 to 21.999, however not all SN's in this range are affected!

Compliance Date:

At the next repack but before 31 December 2019.

Please follow the return RMA procedure on-line at <https://www.vigil.aero/servicing>.

Cost:

- The shipping cost of the AAD to Belgium or to Vigil America will be the customer's responsibility.
- Standard return shipping to the customer will be at no charge to the customer.
- Repack expenses will be the responsibility of the customer.
- A full unit maintenance procedure and an upgrade to the latest firmware version will be performed on each subject Vigil at no charge to the customer.
- Units which still have their original battery, will have the battery replaced at the standard cost. This will avoid customers having to send their unit back within two years for a battery replacement.

Authority:

Jo Smolders
Managing Director

A.A.D. nv/sa

Bd. A. Reyers, 193
1030 Brussels – Belgium – Europe
Tel: +32.2.732.65.52
Fax: +32.2.736.06.27
www.vigil.aero – info@vigil.aero

Vigil America, Inc.

1400 Flightline Blvd., Suite C
DeLand, FL 32724
Tel: +1.386.736.8464
Fax: +1.386.736.8468
www.vigil.aero - candace@vigilamerica.aero

Distribution of this Advisory Product Service Bulletin shall include, but is not limited to:

- All AAD dealers.
- Parachute Industry Association.
- All identified parachuting publications.
- All identified parachuting Federations and Associations
- All National Aero Clubs, Parachuting Section.
- IPC Technical Committee.